

**A00370 MST BELT DRESSING 16net11**

Version 1.0

Revision Date 02/18/2015

Print Date 06/02/2015

**SECTION 1. PRODUCT AND COMPANY IDENTIFICATION**

Material name : A00370 MST BELT DRESSING 16net11

Material number : 00000000001002307

**Manufacturer or supplier's details**

Company : Zep Inc.

Address : 1310 Seaboard Industrial Blvd., NW  
Atlanta, GA 30318

Telephone : 404-352-1680

**Emergency telephone numbers**
**For SDS Information** : Compliance Services 1-877-428-9937

**For a Medical Emergency** : 877-541-2016 Toll Free - All Calls Recorded

**For a Transportation Emergency** : CHEMTREC: 800-424-9300 - All Calls Recorded.  
In the District of Columbia 202-483-7616

**SECTION 2. HAZARDS IDENTIFICATION**
**Emergency Overview**

Appearance	Aerosol containing a liquefied gas
Colour	colourless, light yellow
Odour	characteristic

**GHS Classification**

Flammable aerosols : Category 1  
 Gases under pressure : Liquefied gas  
 Skin irritation : Category 2  
 Eye irritation : Category 2A  
 Specific target organ toxicity - single exposure : Category 3 (Central nervous system)

**GHS Label element**

Hazard pictograms :



Signal word : Danger

Hazard statements : H222 Extremely flammable aerosol.  
 H280 Contains gas under pressure; may explode if heated.  
 H315 Causes skin irritation.  
 H319 Causes serious eye irritation.  
 H336 May cause drowsiness or dizziness.

Precautionary statements : **Prevention:**  
 P210 Keep away from heat, hot surfaces, sparks, open flames

**A00370 MST BELT DRESSING 16net11**

Version 1.0

Revision Date 02/18/2015

Print Date 06/02/2015

and other ignition sources. No smoking.  
 P211 Do not spray on an open flame or other ignition source.  
 P251 Pressurized container: Do not pierce or burn, even after use.  
 P261 Avoid breathing dust/ fume/ gas/ mist/ vapours/ spray.  
 P264 Wash skin thoroughly after handling.  
 P271 Use only outdoors or in a well-ventilated area.  
 P280 Wear eye protection/ face protection.  
 P280 Wear protective gloves.

**Response:**

P302 + P352 IF ON SKIN: Wash with plenty of soap and water.  
 P304 + P340 + P312 IF INHALED: Remove victim to fresh air and keep at rest in a position comfortable for breathing. Call a POISON CENTER or doctor/ physician if you feel unwell.  
 P305 + P351 + P338 IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing.  
 P332 + P313 If skin irritation occurs: Get medical advice/ attention.  
 P337 + P313 If eye irritation persists: Get medical advice/ attention.  
 P362 Take off contaminated clothing and wash before reuse.

**Storage:**

P403 + P233 Store in a well-ventilated place. Keep container tightly closed.  
 P405 Store locked up.  
 P410 + P412 Protect from sunlight. Do not expose to temperatures exceeding 50 °C/ 122 °F.

**Disposal:**

P501 Dispose of contents/container in accordance with local regulation.

**Potential Health Effects****Carcinogenicity:**

<b>IARC</b>	No component of this product present at levels greater than or equal to 0.1% is identified as probable, possible or confirmed human carcinogen by IARC.
<b>ACGIH</b>	No component of this product present at levels greater than or equal to 0.1% is identified as a carcinogen or potential carcinogen by ACGIH.
<b>OSHA</b>	No component of this product present at levels greater than or equal to 0.1% is identified as a carcinogen or potential carcinogen by OSHA.
<b>NTP</b>	No component of this product present at levels greater than or equal to 0.1% is identified as a known or anticipated carcinogen by NTP.

---

**SECTION 3. COMPOSITION/INFORMATION ON INGREDIENTS**
**Hazardous components**

Chemical Name	CAS-No.	Concentration [%]

**A00370 MST BELT DRESSING 16net11**

Version 1.0

Revision Date 02/18/2015

Print Date 06/02/2015

Heptane, branched, cyclic and linear	426260-76-6	>= 30 - < 50
butane	106-97-8	>= 10 - < 20
Stoddard solvent	8052-41-3	>= 10 - < 20
Mineral Oil Mixture	Not Assigned	>= 10 - < 20
propane	74-98-6	>= 5 - < 10
heptane	142-82-5	>= 1 - < 5

**SECTION 4. FIRST AID MEASURES**

- General advice : Move out of dangerous area.  
Show this safety data sheet to the doctor in attendance.  
Do not leave the victim unattended.
- If inhaled : Consult a physician after significant exposure.  
If unconscious place in recovery position and seek medical advice.
- In case of skin contact : If skin irritation persists, call a physician.  
Wash off immediately with plenty of water for at least 15 minutes.  
If on clothes, remove clothes.
- In case of eye contact : Remove contact lenses.  
Protect unharmed eye.  
Keep eye wide open while rinsing.  
If eye irritation persists, consult a specialist.  
If in eyes, rinse with water for 15 minutes.
- If swallowed : Keep respiratory tract clear.  
Never give anything by mouth to an unconscious person.  
If symptoms persist, call a physician.  
DO NOT induce vomiting unless directed to do so by a physician or poison control center.

**SECTION 5. FIREFIGHTING MEASURES**

- Suitable extinguishing media : Alcohol-resistant foam  
Carbon dioxide (CO<sub>2</sub>)  
Dry chemical
- Unsuitable extinguishing media : High volume water jet
- Specific hazards during firefighting : Do not allow run-off from fire fighting to enter drains or water courses.
- Hazardous combustion products : Carbon dioxide (CO<sub>2</sub>)  
Carbon monoxide  
Smoke
- Specific extinguishing methods :  
  
Use extinguishing measures that are appropriate to local circumstances and the surrounding environment.

**A00370 MST BELT DRESSING 16net11**

Version 1.0

Revision Date 02/18/2015

Print Date 06/02/2015

- Further information : Collect contaminated fire extinguishing water separately. This must not be discharged into drains.  
Fire residues and contaminated fire extinguishing water must be disposed of in accordance with local regulations.  
For safety reasons in case of fire, cans should be stored separately in closed containments.  
Use a water spray to cool fully closed containers.
- Special protective equipment for firefighters : Wear self-contained breathing apparatus for firefighting if necessary.

**SECTION 6. ACCIDENTAL RELEASE MEASURES**

- Personal precautions, protective equipment and emergency procedures : Use personal protective equipment.  
Ensure adequate ventilation.  
Remove all sources of ignition.  
Evacuate personnel to safe areas.  
Beware of vapours accumulating to form explosive concentrations. Vapours can accumulate in low areas.
- Environmental precautions : Prevent product from entering drains.  
Prevent further leakage or spillage if safe to do so.  
If the product contaminates rivers and lakes or drains inform respective authorities.
- Methods and materials for containment and cleaning up : Sweep up or vacuum up spillage and collect in suitable container for disposal.  
Soak up with inert absorbent material (e.g. sand, silica gel, acid binder, universal binder, sawdust).

**SECTION 7. HANDLING AND STORAGE**

- Advice on safe handling : Avoid exposure - obtain special instructions before use.  
Avoid contact with skin and eyes.  
For personal protection see section 8.  
Smoking, eating and drinking should be prohibited in the application area.  
Take precautionary measures against static discharges.  
Provide sufficient air exchange and/or exhaust in work rooms.  
Open drum carefully as content may be under pressure.  
Dispose of rinse water in accordance with local and national regulations.  
Do not breathe vapours or spray mist.  
Always replace cap after use.
- Conditions for safe storage : BEWARE: Aerosol is pressurized. Keep away from direct sun exposure and temperatures over 50 °C. Do not open by force or throw into fire even after use. Do not spray on flames or red-hot objects.  
No smoking.  
Containers which are opened must be carefully resealed and kept upright to prevent leakage.  
Observe label precautions.  
Electrical installations / working materials must comply with

**A00370 MST BELT DRESSING 16net11**

Version 1.0

Revision Date 02/18/2015

Print Date 06/02/2015

the technological safety standards.  
Keep in a dry, cool and well-ventilated place.

Materials to avoid : Oxidizing agents  
Store and keep away from bases and alkalis.

**SECTION 8. EXPOSURE CONTROLS/PERSONAL PROTECTION**
**Components with workplace control parameters**

Components	CAS-No.	Value type (Form of exposure)	Control parameters / Permissible concentration	Basis
Heptane, branched, cyclic and linear	426260-76-6	TWA	85 ppm 350 mg/m <sup>3</sup>	NIOSH REL
		C	440 ppm 1,800 mg/m <sup>3</sup>	NIOSH REL
		TWA	500 ppm 2,000 mg/m <sup>3</sup>	OSHA Z-1
		TWA	400 ppm 1,600 mg/m <sup>3</sup>	OSHA P0
		STEL	500 ppm 2,000 mg/m <sup>3</sup>	OSHA P0
butane	106-97-8	TWA	800 ppm 1,900 mg/m <sup>3</sup>	NIOSH REL
		TWA	800 ppm 1,900 mg/m <sup>3</sup>	OSHA P0
Stoddard solvent	8052-41-3	TWA	100 ppm	ACGIH
		TWA	350 mg/m <sup>3</sup>	NIOSH REL
		C	1,800 mg/m <sup>3</sup>	NIOSH REL
		TWA	500 ppm 2,900 mg/m <sup>3</sup>	OSHA Z-1
		TWA	100 ppm 525 mg/m <sup>3</sup>	OSHA P0
propane	74-98-6	TWA	1,000 ppm	ACGIH
		TWA	1,000 ppm 1,800 mg/m <sup>3</sup>	NIOSH REL
		TWA	1,000 ppm 1,800 mg/m <sup>3</sup>	OSHA Z-1
		TWA	1,000 ppm 1,800 mg/m <sup>3</sup>	OSHA P0
heptane	142-82-5	TWA	85 ppm 350 mg/m <sup>3</sup>	NIOSH REL
		C	440 ppm 1,800 mg/m <sup>3</sup>	NIOSH REL
		TWA	500 ppm 2,000 mg/m <sup>3</sup>	OSHA Z-1
		TWA	400 ppm 1,600 mg/m <sup>3</sup>	OSHA P0
		STEL	500 ppm 2,000 mg/m <sup>3</sup>	OSHA P0

**Personal protective equipment**

**A00370 MST BELT DRESSING 16net11**

Version 1.0

Revision Date 02/18/2015

Print Date 06/02/2015

Respiratory protection	: Use respiratory protection unless adequate local exhaust ventilation is provided or exposure assessment demonstrates that exposures are within recommended exposure guidelines.
Hand protection Remarks	: The suitability for a specific workplace should be discussed with the producers of the protective gloves.
Eye protection	: Eye wash bottle with pure water Tightly fitting safety goggles Wear face-shield and protective suit for abnormal processing problems.
Skin and body protection	: impervious clothing Choose body protection according to the amount and concentration of the dangerous substance at the work place.
Hygiene measures	: When using do not eat or drink. When using do not smoke. Wash hands before breaks and at the end of workday.

**SECTION 9. PHYSICAL AND CHEMICAL PROPERTIES**

Appearance	: Aerosol containing a liquefied gas
Colour	: colourless, light yellow
Odour	: characteristic
Odour Threshold	: no data available
pH	: not applicable
Melting point/freezing point	: no data available
Boiling point	: no data available
Flash point	: no data available
Evaporation rate	: no data available
Flammability (solid, gas)	: Extremely flammable aerosol.
Upper explosion limit	: no data available
Lower explosion limit	: no data available
Vapour pressure	: no data available
Relative vapour density	: no data available
Density	: 0.734 g/cm <sup>3</sup>
Solubility(ies)	
Water solubility	: insoluble
Partition coefficient: n-octanol/water	: no data available

**A00370 MST BELT DRESSING 16net11**

Version 1.0

Revision Date 02/18/2015

Print Date 06/02/2015

Auto-ignition temperature : not determined  
Thermal decomposition : no data available  
Viscosity  
Viscosity, kinematic : no data available  
Heat of combustion : 46.56 kJ/g

**SECTION 10. STABILITY AND REACTIVITY**

Reactivity : Stable  
Chemical stability : Stable under normal conditions.  
Possibility of hazardous reactions : Vapours may form explosive mixture with air.  
No decomposition if stored and applied as directed.  
Conditions to avoid : Heat, flames and sparks.  
Extremes of temperature and direct sunlight.  
Incompatible materials : Oxidizing agents  
Amines  
Bases  
Hazardous decomposition products : Carbon oxides

**SECTION 11. TOXICOLOGICAL INFORMATION****Acute toxicity****Components:**

heptane:  
Acute inhalation toxicity : LC50 rat: 103,000 mg/l  
Exposure time: 4 h

**Skin corrosion/irritation****Product:**

Remarks: Irritating to skin.

**Serious eye damage/eye irritation****Product:**

Remarks: Severe eye irritation

**Respiratory or skin sensitisation**

no data available

**A00370 MST BELT DRESSING 16net11**

Version 1.0

Revision Date 02/18/2015

Print Date 06/02/2015

**Germ cell mutagenicity**

no data available

**Carcinogenicity**

no data available

**Reproductive toxicity**

no data available

**Heptane, branched, cyclic and linear:****butane:****Stoddard solvent:****Mineral Oil Mixture:****propane:****heptane:****STOT - single exposure**

no data available

**STOT - repeated exposure**

no data available

**Aspiration toxicity**

no data available

**Further information****Product:**

Remarks: Symptoms of overexposure may be headache, dizziness, tiredness, nausea and vomiting., Concentrations substantially above the TLV value may cause narcotic effects., Solvents may degrease the skin.

---

**SECTION 12. ECOLOGICAL INFORMATION****Ecotoxicity**

no data available

**Persistence and degradability**

no data available

**Bioaccumulative potential****Product:**

Partition coefficient: n-  
octanol/water : Remarks: no data available

**Components:****butane :**

Partition coefficient: n-  
octanol/water : Pow: 2.89

**heptane :**

Partition coefficient: n-  
octanol/water : log Pow: > 3.0



**A00370 MST BELT DRESSING 16net11**

Version 1.0

Revision Date 02/18/2015

Print Date 06/02/2015

log Pow: 5

**Mobility in soil**

no data available

**Other adverse effects**

no data available

**Product:**

Regulation	40 CFR Protection of Environment; Part 82 Protection of Stratospheric Ozone - CAA Section 602 Class I Substances
Remarks	This product neither contains, nor was manufactured with a Class I or Class II ODS as defined by the U.S. Clean Air Act Section 602 (40 CFR 82, Subpt. A, App.A + B).
Additional ecological information	: An environmental hazard cannot be excluded in the event of unprofessional handling or disposal., Very toxic to aquatic life., Toxic to aquatic life with long lasting effects.

---

**SECTION 13. DISPOSAL CONSIDERATIONS**
**Disposal methods**

Waste from residues	: The product should not be allowed to enter drains, water courses or the soil. Do not contaminate ponds, waterways or ditches with chemical or used container. Dispose of in accordance with local regulations.
Contaminated packaging	: Empty remaining contents. Dispose of as unused product. Do not re-use empty containers. Do not burn, or use a cutting torch on, the empty drum.

---

**SECTION 14. TRANSPORT INFORMATION**

Transportation Regulation: 49 CFR (USA): ORM-D, CONSUMER COMMODITY
---

Transportation Regulation: IMDG (Vessel): UN1950, AEROSOLS, 2.1, - Limited quantity
--

Transportation Regulation: IATA (Cargo Air): UN1950, Aerosols, flammable, 2.1, - Limited quantity
--

Transportation Regulation: IATA (Passenger Air): UN1950, Aerosols, flammable, 2.1, - Limited quantity
--

**A00370 MST BELT DRESSING 16net11**

Version 1.0

Revision Date 02/18/2015

Print Date 06/02/2015

 Transportation Regulation: TDG (Canada):  
 UN1950, AEROSOLS, 2.1, - Limited quantity

**SECTION 15. REGULATORY INFORMATION**
**EPCRA - Emergency Planning and Community Right-to-Know Act**
**CERCLA Reportable Quantity**

Components	CAS-No.	Component RQ (lbs)	Calculated product RQ (lbs)
xylenes	1330-20-7	100	*

\*: Calculated RQ exceeds reasonably attainable upper limit.

**SARA 304 Extremely Hazardous Substances Reportable Quantity**

This material does not contain any components with a section 304 EHS RQ.

**SARA 311/312 Hazards** : Fire Hazard  
 Sudden Release of Pressure Hazard  
 Acute Health Hazard

**SARA 302** : SARA 302: No chemicals in this material are subject to the reporting requirements of SARA Title III, Section 302.

**SARA 313** : SARA 313: This material does not contain any chemical components with known CAS numbers that exceed the threshold (De Minimis) reporting levels established by SARA Title III, Section 313.

**California Prop 65** This product does not contain any chemicals known to State of California to cause cancer, birth defects, or any other reproductive harm.

**The components of this product are reported in the following inventories:**

**TSCA** On TSCA Inventory  
**DSL** This product contains the following components that are not on the Canadian DSL nor NDSL.  
**AICS** Not in compliance with the inventory  
**NZIoC** Not in compliance with the inventory  
**PICCS** Not in compliance with the inventory  
**IECSC** Not in compliance with the inventory

**Inventory Acronym and Validity Area Legend:**

AICS (Australia), DSL (Canada), IECSC (China), REACH (European Union), ENCS (Japan), ISHL (Japan), KECl (Korea), NZIoC (New Zealand), PICCS (Philippines), TSCA (USA)

**SECTION 16. OTHER INFORMATION**

## A00370 MST BELT DRESSING 16net11


Version 1.0

Revision Date 02/18/2015

Print Date 06/02/2015

## Further information

## NFPA:

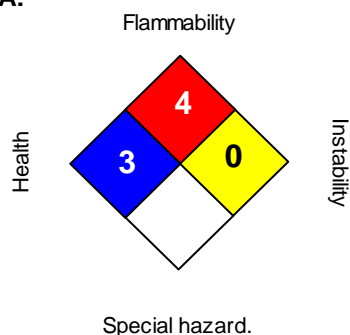

## HMIS III:

<b>HEALTH</b>	<b>3</b>
<b>FLAMMABILITY</b>	<b>4</b>
<b>PHYSICAL HAZARD</b>	<b>2</b>

0 = not significant, 1 = Slight,  
2 = Moderate, 3 = High  
4 = Extreme, \* = Chronic

## OSHA GHS Label Information:

Hazard pictograms



Signal word

Hazard statements

Precautionary statements

: **Danger:**

: Extremely flammable aerosol. Contains gas under pressure; may explode if heated. Causes skin irritation. Causes serious eye irritation. May cause drowsiness or dizziness.

:

**Prevention:** Keep away from heat, hot surfaces, sparks, open flames and other ignition sources. No smoking. Do not spray on an open flame or other ignition source. Pressurized container: Do not pierce or burn, even after use. Avoid breathing dust/ fume/ gas/ mist/ vapours/ spray. Wash skin thoroughly after handling. Use only outdoors or in a well-ventilated area. Wear eye protection/ face protection. Wear protective gloves.

**Response:** IF ON SKIN: Wash with plenty of soap and water. IF INHALED: Remove victim to fresh air and keep at rest in a position comfortable for breathing. Call a POISON CENTER or doctor/ physician if you feel unwell. IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing. If skin irritation occurs: Get medical advice/ attention. If eye irritation persists: Get medical advice/ attention. Take off contaminated clothing and wash before reuse.

**Storage:** Store in a well-ventilated place. Keep container tightly closed. Store locked up. Protect from sunlight. Do not expose to temperatures exceeding 50 °C/ 122 °F.

**Disposal:** Dispose of contents/container in accordance with local regulation.

We believe the statements, technical information and recommendations contained herein are reliable, but they are given without warranty or guarantee of any kind. The information in this document applies to this specific material as supplied. It may not be valid for this material if it is used in combination with any other materials. Users should make their own investigations to determine the suitability and applicability of the information for their particular purposes.

This SDS has been prepared by the Compliance Services organization supporting this manufacturer, supplier or distributor.

Zep Inc. markets products under well recognized and established brand names such as Zep®, Zep Commercial®, Zep Professional®, Enforcer®, National Chemical™, Selig™, Misty®, Next Dimension™, Petro®, i-Chem®, TimeMist®, TimeWick™, MicrobeMax®, Country Vet®,

**A00370 MST BELT DRESSING 16net11**

Version 1.0

Revision Date 02/18/2015

Print Date 06/02/2015

Konk®, Original Bike Spirits®, Blue Coral®, Black Magic®, Rain-X®, Niagara National™, FC Forward Chemicals®, Rexodan®, Mykal™, and a number of private labeled brands.